

## **IICL TB 003**, 1 May 2005

## Title: "Finger Cracking in Plywood Floor Boards".

The IICL is revising the inspection criteria for plywood flooring effective May 1, 2005.

**Reference:** IICL "Gray Areas" Manual 2<sup>nd</sup> Ed. Section 3.4


## **Finger Cracking - Definition**

A "<u>finger crack</u>" is a separation in a surface veneer running transverse combined with separations running longitudinal at both ends of the transverse separation.

## **Revised Criteria**

Not all cases of finger cracking will be repair worthy. Finger cracking will be repair worthy only **when** accompanied by one or more of the following conditions:

- Visible sign of impact on the opposite side
- Damage to adjacent components, i.e., crossmembers, sills, floor rails, hat sections
- Visible bowing of the opposite side of the floor
- Hollow sound when hammer tested

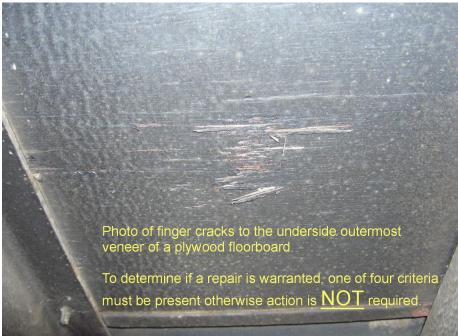

555 Pleasantville Road, Suite 140 South Br Telephone: (1) 914 747-9100 Fax: (1) 914 747-4600

BRIARCLIFF MANOR, NY 10510 USA E-MAIL: info@iicl.org WEBSITE: www.iicl.org IICL TB 003 was prepared under the supervision of the following representatives from IICL member companies:

Container Applications Limited (CAI) Textainer Equipment Management (U.S.) Ltd. Triton Container International Ltd. Florens Container Services (USA) Ltd. Mike Hohndorf Jack Figueira Hank Heacox Luiz Goncalves